

FIRMWARE RELEASE BULLETIN

New! Taktis UL firmware release

In line with our program of continuous product development Kentec have released a new firmware version UL1204-02.051 for the UL approved Taktis Addressable fire alarm control panel and its OEM branded variants.

Release date: 29th June 2020

Firmware UL1204-02.051 further enhances the performance and reliability of the Kentec Taktis UL control panel. To successfully use UL1204-02.051 you will require LE2 configuration software to version 3.339.03.

New features

Hochiki PU-F Detectors

Enhancements have been made to the implementation of the new PU-F detectors to include a time and date stamped history log for alarm events, as well as enhanced fault reporting.

Notable improvements

HA Devices

Reported numerous HA devices were responding out of specification, changes have been made to timings to resolve this.

Apollo Dual Priority Switch Monitor Module

All input actions are now available through the GUI for this device.

Location text

Submit button for location text is now available for all devices.

Hochiki Temporal 4 Sync pattern

Corrections have been made to the Temporal 4 Sync pattern in comparison to the global pattern temporal 3

Zonal mode

Corrections have been made to ensure in zonal mode only devices in the associated zone operate.

AC failure report delay

Delay was not functioning correctly; this has now been resolved.

Strobe silence

Strobe silence option now displays correctly on the GUI.

Resound alarms button

Resound alarms button was not available for event types SUPERV or CO. This has now been corrected.

Plug-in cards

Plug in cards included in a LE2 configuration are reported as unexpected on the panel after an upload. This has now been corrected.

DCP-MIOMH (Multiple Input/Output Module) Hochiki

Issue with enabling inputs and outputs following a disablement has now been resolved.

NAC current limit value

Issues regarding setting and transfer of NAC current limit values have been resolved.

Temporal 4 pattern sync

Temporal 4 patterns are now in sync in zonal mode.

ACE Modes

Modes for Hochiki ACE devices are now correctly displayed on the GUI

NAC synchronisation

NAC circuits are now synchronised for non-fire event types.

Input setting "Waterflow Non-silenceable"

All outputs associated with an input set for "Waterflow Non-silenceable" cannot be silenced.

Conventional zone module S792

Reset timings have been increased to ensure maximum start up times are accommodated for all supported detectors.

Loop open circuit faults

The issue causing loop open circuit faults after a loop initialisation has now been rectified.

SLC output devices

An option to set output devices as supervisory has been added to the GUI

Function button 24

Function button 24 on GUI now operates correctly

Hochiki ATJ-EA

Available temperature levels have been amended for this device also settings have been corrected.

Hochiki ACC-V device

Corrections have been made to the activations of ACC-V devices to ensure they activate the correct state under all conditions. Amendments have also been made to day/night mode settings to prevent false alarms on switch over.

Event details

Improvements have been made so more details can be viewed for events

It is strongly recommended that Taktis panels in the field be upgraded to the latest firmware at the earliest opportunity. Upgrading panel firmware in the field ensures access to the latest features and improvements.

To obtain the latest firmware files along with advice and instructions on upgrade requirements please contact our Technical Support department.

Should you require info on any of our products please contact your sales representative.

Regards

Philip J Barton

Commercial Product Manager



Bulletin no. PR1061/23072020 Rev. 1

For further information visit

www.kentec.co.uk

Although every effort has been made to ensure the accuracy of the information contained in this document it is not warranted or represented by Kentec Electronics Ltd. to be a complete and up-to-date description.